



www.BeSoji.com



COMPREHENSIVE YELLOW BOOK

BESOJI FZ-LLC,
IN5 TECH, MEDIA CITY

+971 56 817 8171
HELLO@BESOJI.COM

**Date**

Saturday, September 11, 2021

Time

06:20 PM

Vehicle Details**Make**

SUBARU

Model

WRX

Year

2014

Engine Size

4-Cylinder

Mileage (KM)

72815

Fuel Type

Petrol

Regional Specs

GCC

Transmission

Manual

Interior

Leather

VIN Number

JF1VA22K0FGXXXXX

Number of Keys

1

Spare Tire

Available

Engine

Engine Upper Cover

Missing

Engine Shield Cover

Missing

Engine Mounts

Pass

Engine Oil Level

Pass

Engine Oil Leaks

Leak from valve cover/camshaft gasket

Engine Oil Filler Cap

Pass

Coolant Level

Pass

Coolant Cap

Pass

Turbo / Supercharger

Pass

Visible Rust

Minor rust on exhaust

Exhaust System

Pass

Engine Idle

Pass

Bonnet Hinge & Holder

Pass

Fender Liners

Liners missing

Drive Belt / Pulleys

Pass

Hoses & Pipes

Pass

Radiator

Pass

Battery Condition ★★★★★

Engine Fault Photos

Engine Cover Fault - Photo



[16313708770281585217921770579191](#)

Shield Cover Fault - Photo



[16313708668913598464034294711374](#)

Engine Oil Leak Fault - Photo



[16313710212081775605396344464155](#)

Fender Liners Fault - Photo



[16313709471463761176569491876949](#)



[16313709576587581552606969406581](#)

Visible Rust Fault - Photo

SAMPLE



[16313711131223623764866515554260](https://www.16313711131223623764866515554260.com)

Transmission

Fluid Level & Condition

Pass

Gear Selector

Pass

Noise

Pass

Transmission Fault Photos

Transmission Fluid Leaks

From rear differential

Gear Shifting

Pass

Transmission Fluid Fault - Photo



Please review the car diagnostic report at the end of this document for more information on the transmission condition.

Electrical System

Key Remote

Pass

Entertainment System

Pass

Center Console Buttons

Scratch near gear lever,
crack above radio

Door Lock / Unlock

Pass

Cameras

Pass

Cruise Control

Pass

A/C Control & Cooling

Pass

Starting & Ignition System

When trying to start engine,
there's a slight delay due to
battery

Gauges

Air bag light is on

Fog Lights

Pass

Headlights

Pass

Brake Lights

Pass

A/C Grilles

Pass

High Beams

Pass

Reverse Lights

Pass

Number Plate Lights

Pass

Indicators & Hazards

Pass

Soft Closing Doors

N/A

Wipers

Water pump not working

Interior Lights

Pass

Sunroof / Moonroof

Pass

Windows Operation

Front right side and rear left
side not working

Horn

Pass

Parking Sensors Fault

Pass

Seats Adjustment (Power/Manual)

Pass

Rear View / Side Mirror Electricals

Pass

Electrical System Faults

Windows Operation Fault



[16313719046748552863449043303849](#)

Wipers Fault



[16313723017976379289929886551038](#)



[16313719146422554625883883954111](#)

Center Console Buttons Fault



[16313719816804004316862478328241](#)



16313719934491941633219938892970

Gauges Fault



16313720497123089507249448919937

Brake System, Suspension & Tyres

Brake Pads Front

Brake pads need to be replaced

Brake Discs Front

Discs are rusty & worn out, need to be replaced

ABS Sensors

Pass

Front Suspension

Both sides front shock absorbers are leaking

Brake Pads Rear

Pass

Brake Discs Rear

Discs are rusty & worn out, need to be replaced

Handbrake

Pass

Rear Suspension

Pass

Rims

	Brand	Condition
Front Left	Original	Minor curb scratches
Front Right	Original	Minor curb scratches
Rear Left	Original	Minor curb scratches
Rear Right	Original	Scratch
Spare	Original	

Tyres

	Manufacturer	Date	Size	Condition
Front Left	NITTO NT01	2020	245/40ZR18	Good
Front Right	NITTO NT01	2020	245/40ZR18	Good
Rear Left	NITTO NT01	2020	245/40ZR18	Good
Rear Right	NITTO NT01	2020	245/40ZR18	Good
Spare	Original			



Front Left Tyre

Front Right Tyre

Rear Left Tyre

Rear Right Tyre



Interior

Roof Lining

Pass

Rear View Mirror

Pass

Armrest & Side Pockets

Pass

Steering Wheel Upholstery

Not original

Seats Upholstery

Cracked due to wear and tear. Scratches are prominent.

Gear Lever

Minor scratches

Floor Mats

Pass

Trunk Lining

Pass

Dashboard

Pass

Front Windscreen

Pass

Rear Windscreen

Pass

Doors

Pass

Service History & Manuals

Service History

Not Available

User Manual

Not Available

Interior Faults

Steering Wheel Upholstery Fault



[16313725039467182428359223230015](#)

Gear Lever Fault



[16313725965894630234805349285097](#)

Seats Upholstery Fault



[16313725350958555498086545919365](#)



[16313725456002523944994619472848](#)

SAFARI








[16313725559235563763537091856997](https://www.16313725559235563763537091856997)

Exterior & Interior Report


Paint Condition

BeSoji
Exterior Condition Report

- Scratch
- Chip
- Dent
- Repainted
- Faded

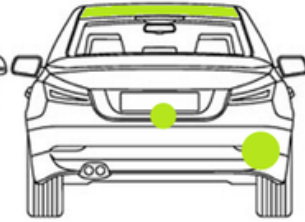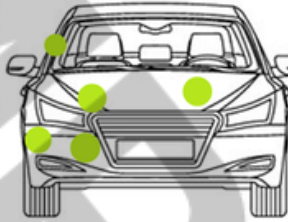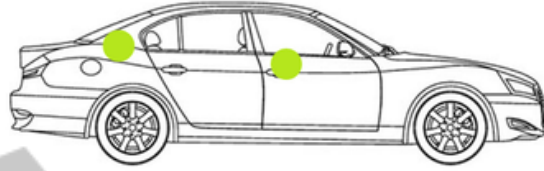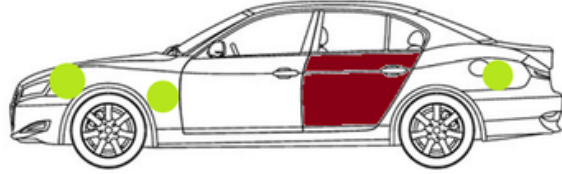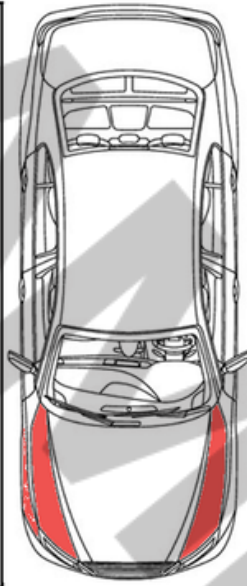

BeSoji Chassis Damage Report

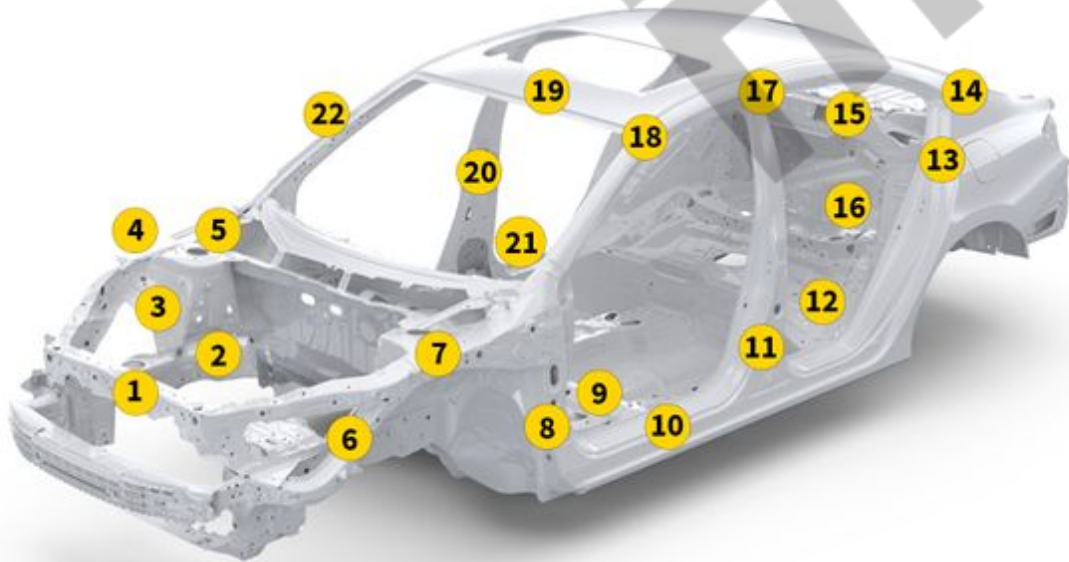

Damage on chassis:

PASS

Exterior Photos

File Upload



[IMG_20210911_181610.jpg](#)



[IMG_20210911_181615.jpg](#)



[IMG_20210911_181624.jpg](#)



[IMG_20210911_181630.jpg](#)



[IMG_20210911_181638.jpg](#)



[IMG_20210911_181643.jpg](#)



[IMG_20210911_181649.jpg](#)



[IMG_20210911_181653.jpg](#)



[IMG_20210911_181657.jpg](#)



[IMG_20210911_181701.jpg](#)



[IMG_20210911_181706.jpg](#)



[IMG_20210911_181711.jpg](#)



[IMG_20210911_181718.jpg](#)



[IMG_20210911_181723.jpg](#)



[IMG_20210911_181727.jpg](#)



[IMG_20210911_181732.jpg](#)



[IMG_20210911_181748.jpg](#)



[IMG_20210911_181754.jpg](#)



IMG_20210911_181800.jpg



IMG_20210911_181804.jpg



IMG_20210911_181811.jpg



IMG_20210911_181818.jpg



IMG_20210911_181821.jpg



IMG_20210911_181824.jpg



IMG_20210911_181831.jpg



IMG_20210911_181838.jpg



IMG_20210911_182007.jpg



IMG_20210911_182011.jpg



IMG_20210911_182139.jpg

MPRE

Engine Bay & Undercarriage

File Upload



[IMG_20210911_182215.jpg](#)



[IMG_20210911_182220.jpg](#)



[IMG_20210911_182224.jpg](#)



[IMG_20210911_182315.jpg](#)



[IMG_20210911_182319.jpg](#)



[IMG_20210911_182332.jpg](#)



[IMG_20210911_182337.jpg](#)



[IMG_20210911_182341.jpg](#)



IMG_20210911_182356.jpg



IMG_20210911_182401.jpg



IMG_20210911_182412.jpg



IMG_20210911_182416.jpg



IMG_20210911_182429.jpg



IMG_20210911_182434.jpg



IMG_20210911_182438.jpg



IMG_20210911_182454.jpg



IMG_20210911_182458.jpg



IMG_20210911_182502.jpg



IMG_20210911_182505.jpg




IMG_20210911_184108.jpg



IMG_20210911_184119.jpg



IMG_20210911_184134.jpg

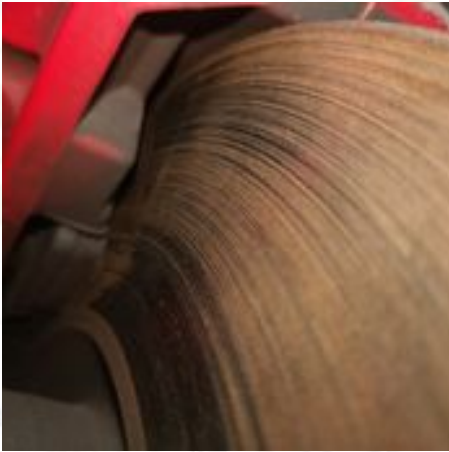

IMG_20210911_184144.jpg



Interior Photos

File Upload



[16313735981006143731923943743368.](#)



[16313736182265556406109427822981.](#)



[IMG_20210911_181852.jpg](#)



[IMG_20210911_181848.jpg](#)



[IMG_20210911_181857.jpg](#)



[IMG_20210911_181941.jpg](#)



[IMG_20210911_181949.jpg](#)



IMG_20210911_182001.jpg



IMG_20210911_181957.jpg



IMG_20210911_182018.jpg



IMG_20210911_182022.jpg



IMG_20210911_182054.jpg



IMG_20210911_182058.jpg



IMG_20210911_182107.jpg



IMG_20210911_182111.jpg



Vehicle Diagnostic Report



File Upload



Terms of Service

All services from BeSoji are provided on an "as is, with all defects" and "as available" basis without warranties of any kind, either expressed or implied, including without limitation, warranties of title, non-infringement, or implied warranties of merchantability or fitness for a particular purpose. Nothing in these terms or in any description of products or services in the services shall constitute a representation or warranty with respect to such products or services.

The inspection of the vehicle described in this report is external and we are unable to accept responsibility for failure to identify defects not present or apparent at the time of the inspection. Odometer readings may have been tampered with, although we report any signs that we notice of this happening during inspection. You acknowledge, by your use of the services, that such use is at your sole risk. In the event of dissatisfaction or a complaint, we reserve the right to re-examine the vehicle prior to any rectifications to the vehicle. You agree that BeSoji's liability is limited to refunding the price you pay for the inspection in the event you are dissatisfied with BeSoji's service, or injuries occur due to an unreported defect in the vehicle. All requests should be sent to hello@besoji.com within 7 days notice of receiving the report.

in no event shall either BeSoji or its affiliates or agents be liable for any direct, indirect, punitive, incidental, special or consequential damages arising out of or in any way connected with the use of the services, whether based on contract, tort, strict liability or otherwise, even if advised of the possibility of any such damages.